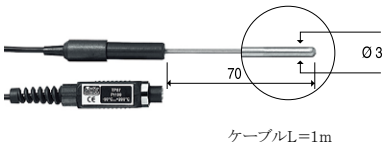


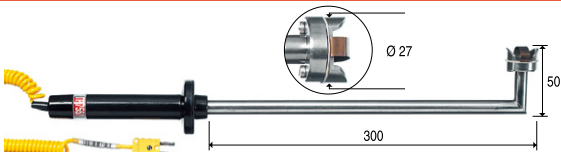
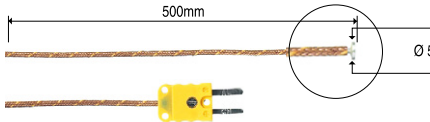
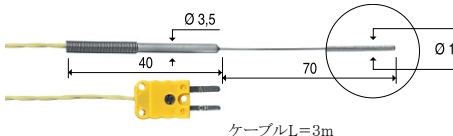
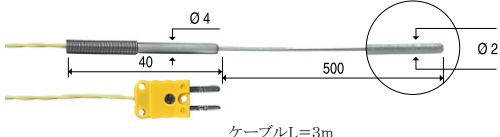
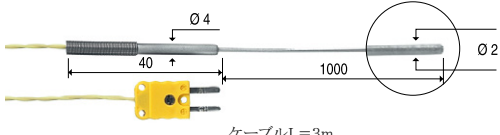
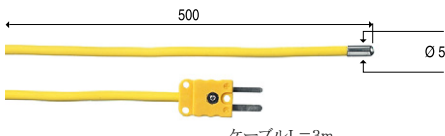

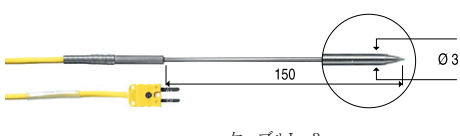

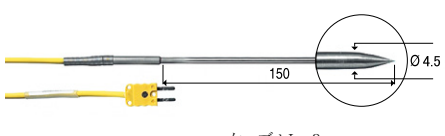


ポータブル測定器用 Pt100・Pt1000センサプローブ(接続用コネクタTP47付)					
■ご注文コード	℃ max	τ 0.63	外形寸法	用途	
	精度				
TP47.100.0 (Pt100、4線式) TP47.1000.0 (Pt1000、4線式)	-50～+250	3s	 ケーブルL=2m		HD2101.1/2 HD2103.1/2 HD2105.1/2 HD2106.1/2 HD2156.1/2 HD2107.1/2 HD2114.0/2 HD2134.0/2 HD2164.0/2 HD2114B.0/2 HD2124.1/2 HD2127.1/2 HD2178.1/2 HD2301.0/3.0 HD2304.0/5.0 HD2306.0/7.0 HD32.1/7 HD31 HD3114B
TP87.100.0 (Pt100、4線式)	-50～+200	3s	 ケーブルL=1m		
TP47	プローブ接続用コネクタ (コネクタのみ、内部回路なし) 4線式Pt100、3線式Pt100、 2線式Pt1000接続用				
PRT白金センサ用 SICRAMモジュール					
TP471	PRTの抵抗値(@0℃):100Ω 測定範囲 Pt100: -200℃～+850℃ 精度 Pt100: ±0.03℃(+350℃まで) ±0.3℃(+850℃まで)			HD31	

K熱電対プローブ(クロメル - アルメル)					
■ご注文コード	°C max	τ 0.63	外形寸法	用途	
	許容誤差				
TP746	+250	2s			HD2178.1 HD2178.2 HD2114P.0 HD2114P.2 HD2134P.0 HD2134P.2 HD32.8.8 HD32.8.16 HD31
	K熱電対(IEC/JISクラス1)				
TP755	+300	2s			
	K熱電対(IEC/JISクラス1)				
TP755/9	+300	2s			
	K熱電対(IEC/JISクラス1)				
TP772	+400	3s			
	K熱電対(IEC/JISクラス1)				
TP647 TP647/2 TP647/3 TP647/5 TP647/10 TP647/20	+300	2s			
	K熱電対(IEC/JISクラス1)				

K熱電対プローブ(クロメル - アルメル)					
■ご注文コード	℃ max	τ0.63	外形寸法	用途	
	許容誤差				
TP651	+1200	6s			HD2178.1 HD2178.2 HD2114P.0 HD2114P.2 HD2134P.0 HD2134P.2 HD32.8.8 HD32.8.16 HD31
	K熱電対(IEC/JISクラス1)				
TP652	+1200	6s			
	K熱電対(IEC/JISクラス1)				
TP656	+200	1s			
	K熱電対(IEC/JISクラス1)				
TP656/1	+1000	1s			
	K熱電対(IEC/JISクラス1)				
TP656/2	+1000	1s			
	K熱電対(IEC/JISクラス1)				
TP657/1	+100	5s			
	K熱電対(IEC/JISクラス1)				
TP662	+110	120s			
	K熱電対(IEC/JISクラス1)				
TP659	+400	3s			
	K熱電対(IEC/JISクラス1)				
TP660	+400	4s			
	K熱電対(IEC/JISクラス1)				
CM CS PW	"K" "K" "K"		  		
			CM	CS	PW